


HELEN
E-2011

E-BUTT

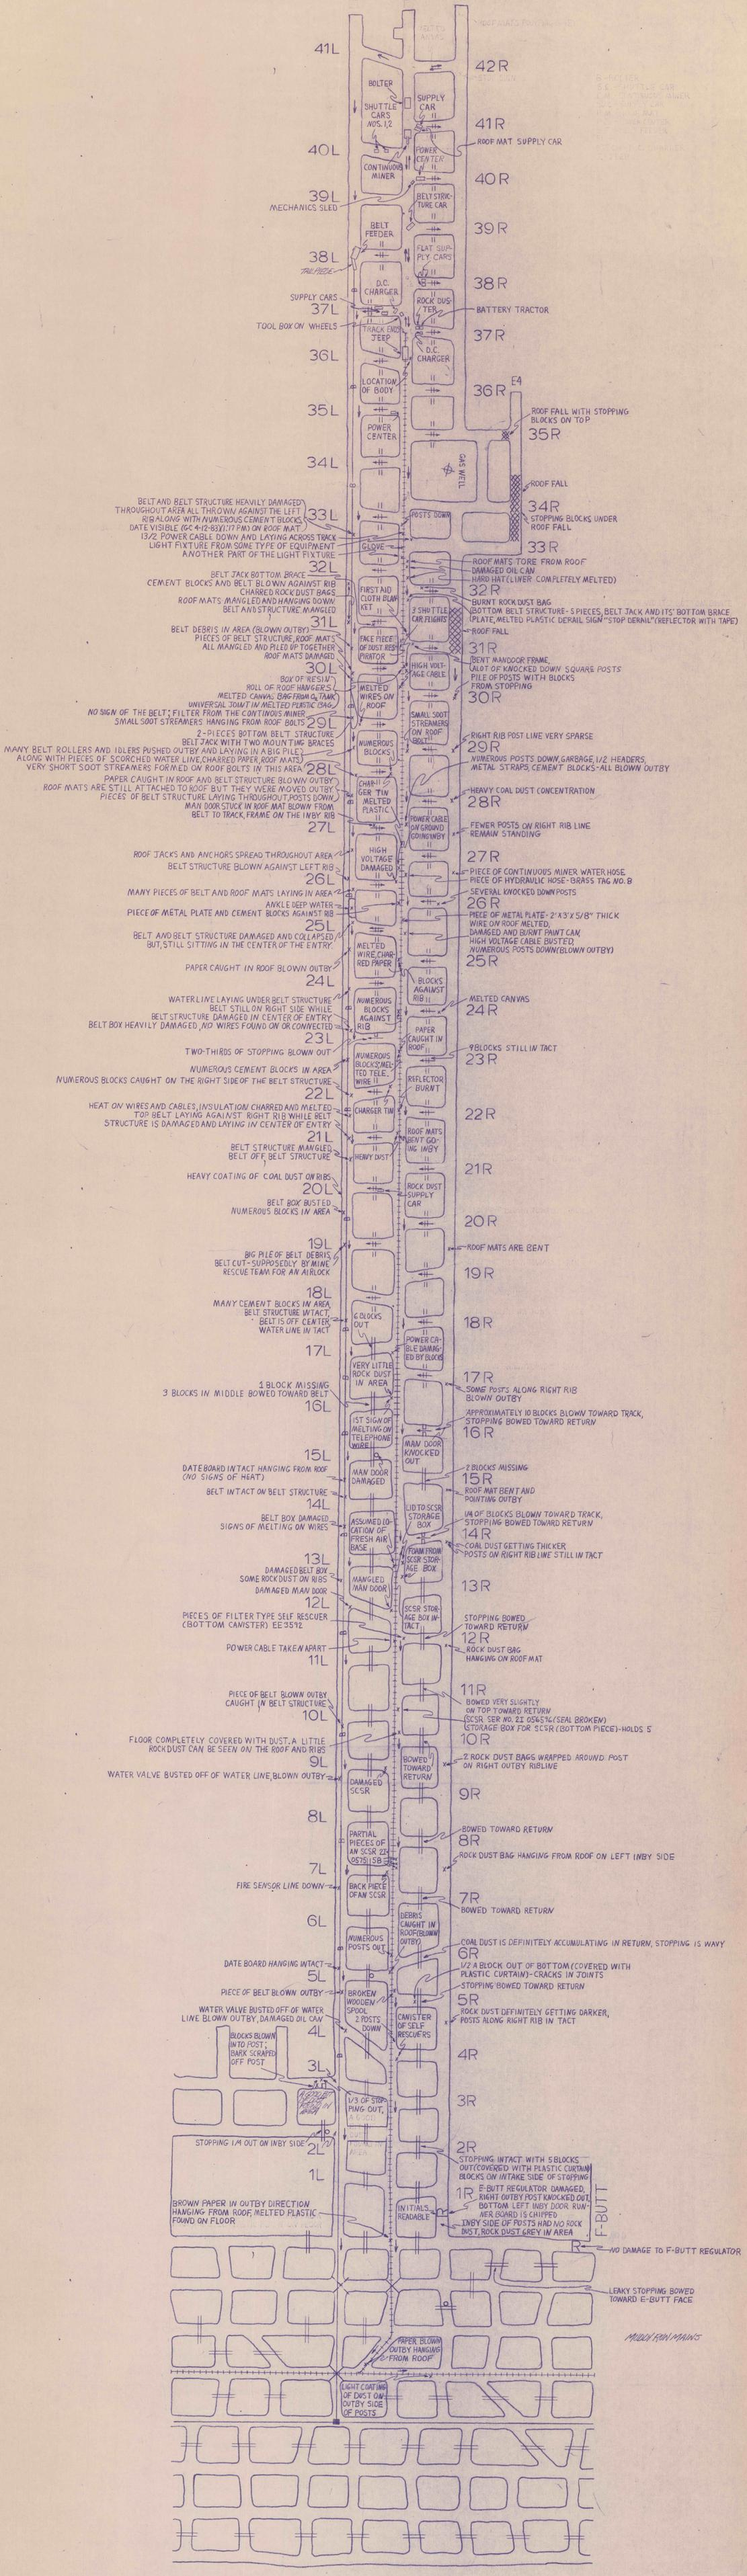

41L
40L
39L
38L
37L
36L
35L
34L
33L
32L
31L
30L
29L
28L
27L
26L
25L
24L
23L
22L
21L
20L
19L
18L
17L
16L
15L
14L
13L
12L
11L
10L
9L
8L
7L
6L
5L
4L
3L
2L
1L

42R
41R
40R
39R
38R
37R
36R
35R
34R
33R
32R
31R
30R
29R
28R
27R
26R
25R
24R
23R
22R
21R
20R
19R
18R
17R
16R
15R
14R
13R
12R
11R
10R
9R
8R
7R
6R
5R
4R
3R
2R
1R

MECHANICS SLED
BOLT
SHUTTLE CARS NOS. 12
CONTINUOUS MINER
BOLT FEEDER
D.C. CHARGER
SUPPLY CARS
TOOL BOX ON WHEELS
TRACK END JEEP
LOCATION OF BODY
POWER CENTER
GAS WELL
ROCK DUST
BATTERY TRACTOR
D.C. CHARGER
ROOF MAT SUPPLY CAR
BOLT FEEDER
FLAT SUPPLY CARS
BOLT FEEDER
ROOF MAT SUPPLY CAR
ROOF FALL WITH STOPPING BLOCKS ON TOP
ROOF FALL
STOPPING BLOCKS UNDER ROOF FALL
ROOF MATS TORE FROM ROOF
DAMAGED OIL CAN
HARD HAT (LINER COMPLETELY MELTED)
BURNT ROCK DUST BAG
BOTTOM BELT STRUCTURE - 5 PIECES, BELT JACK AND ITS' BOTTOM BRACE (PLATE, MELTED PLASTIC DERAIL SIGN "STOP DERAIL" (REFLECTOR WITH TAPE)
BENT MAN DOOR FRAME
LADDER OF KNOCKED DOWN SQUARE POSTS
PILE OF POSTS WITH H BLOCKS FROM STOPPING
SMALL SOOT STREAMERS HANGING FROM ROOF BOLTS
NUMEROUS BLOCKS IN THIS AREA
CHAR-GER TIM MELTED PLASTIC
HIGH VOLTAGE CABLE ON GROUND GOING INBY
POWER CABLE ON ROOF MELTED
PIECE OF CONTINUOUS MINER WATER HOSE
PIECE OF HYDRAULIC HOSE - BRASS TAG NO. 8
SEVERAL KNOCKED DOWN POSTS
PIECE OF METAL PLATE - 2' X 3' X 5/8" THICK WIRE ON ROOF MELTED, DAMAGED AND BURNT PAINT CAN, HIGH VOLTAGE CABLE BUSTED, NUMEROUS POSTS DOWN (BLOWN OUTBY)
BLOCKS AGAINST RIB
PAPER CAUGHT IN ROOF BLOWN OUTBY
NUMEROUS BLOCKS AGAINST RIB
REFLECTOR BURNT
CHARGER TIM
ROOF MATS NOT GOING INBY
ROCK DUST SUPPLY CAR
ROOF MATS ARE BENT
ROOF MATS ARE BENT
APPROXIMATELY 10 BLOCKS BLOWN TOWARD TRACK, STOPPING BOWED TOWARD RETURN
MAM DOOR KNOCKED OUT
LID TO SCSR STORAGE BOX
FROM FROM SCSR STORAGE BOX
SCSR STORAGE BOX INTACT
STOPPING BOWED TOWARD RETURN
ROCK DUST BAG HANGING ON ROOF MAT
BOWED VERY SLIGHTLY ON TOP TOWARD RETURN (SCSR SER. NO. 21 056574 (SEAL BROKEN) STORAGE BOX FOR SCSR (BOTTOM PIECE) - HOLDS 5
BOWED TOWARD RETURN
2 ROCK DUST BAGS WRAPPED AROUND POST ON RIGHT OUTBY RIBLINE
BOWED TOWARD RETURN
ROCK DUST BAG HANGING FROM ROOF ON LEFT INBY SIDE
BOWED TOWARD RETURN
DEBRIS CAUGHT IN ROOF (BLOWN OUTBY)
COAL DUST IS DEFINITELY ACCUMULATING IN RETURN, STOPPING IS WAVY
1/2 A BLOCK OUT OF BOTTOM COVERED WITH PLASTIC CURTAIN - CRACKS IN JOINTS
STOPPING BOWED TOWARD RETURN
ROCK DUST DEFINITELY GETTING DARKER, POSTS ALONG RIGHT RIB IN TACT
BLOCKS BLOWN INTO POST; BARK SCRAPPED OFF POST
1/3 OF STOPPING OUT, A COOL AREA
STOPPING 1/4 OUT ON INBY SIDE
BROWN PAPER IN OUTBY DIRECTION HANGING FROM ROOF, MELTED PLASTIC FOUND ON FLOOR
INITIALS READABLE
INBY SIDE OF POSTS HAD NO ROCK DUST, ROCK DUST GREY IN AREA
NO DAMAGE TO F-BUTT REGULATOR
LEAKY STOPPING BOWED TOWARD E-BUTT FACE
MUD ON MAINS
LIGHT COATING OF DUST ON OUTBY SIDE OF POSTS

LEGEND

OVERCAST
STOPPING
STOPPING WITH DOOR
BLOWN OUT STOPPING
PARTIAL STOPPING
DIRECTION OF FORCE
REGULATOR
TRACK
BELT LOCATION BEFORE EXPLOSION

HOMER CITY MINE
HELEN MINING COMPANY
ID-3600926
SCALE: 1 INCH = 50 FEET