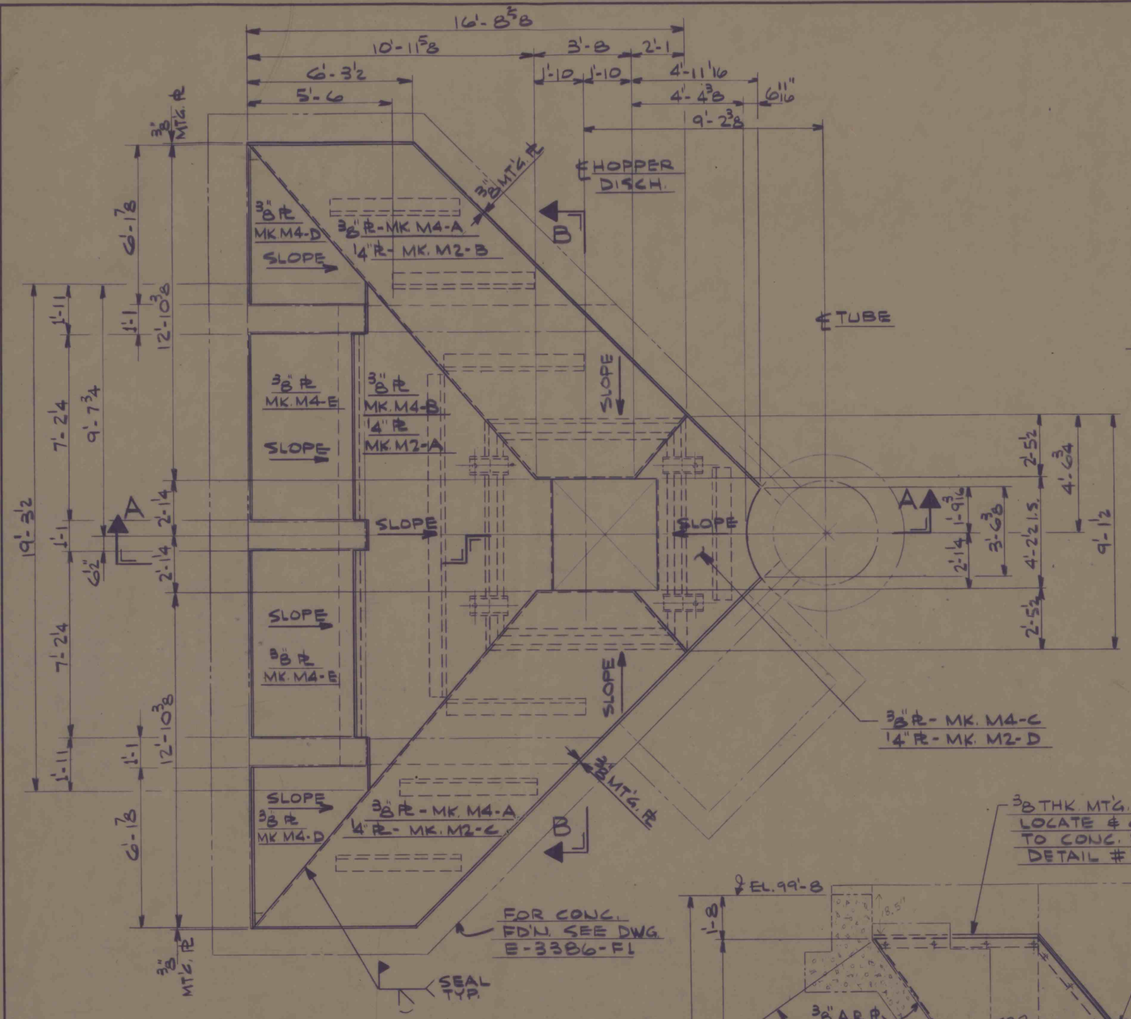

PLAN VIEW

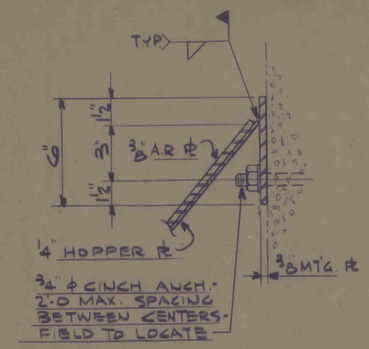

DETAIL # 2

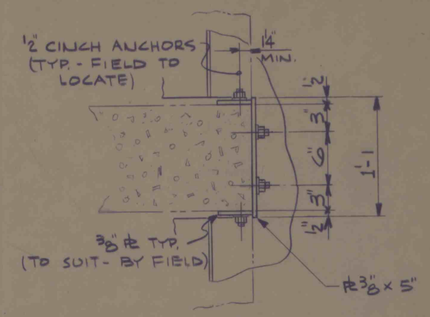

SECTION C-C

NOTES:

1.) INSTALLATION - INSTALL 3/8" PL'S MK M4-E FIRST BY SECURING TO CONC. W/ 1/2" ϕ CINCH ANCHORS (USE HOLES IN PL'S AS A TEMPLATE), THEN INSTALL THE HOPPER WALL ASSY'S (1/4" HOPPER PL'S W/ 3/8" LINER PL'S WELDED ON IN THE SHOP) AS SHOWN. FIELD TO LOCATE & MOUUT 3/8" PL'S MK M4-D USING SAME METHOD AS FOR MK'S. M4-E. AFTER LOCATING PL'S, FIELD TO SEAL-WELD ALL SEAMS DUST-TIGHT TO PREVENT COAL DUST FROM LEAKING THROUGH INTO FEEDER COMPARTMENT BELOW.

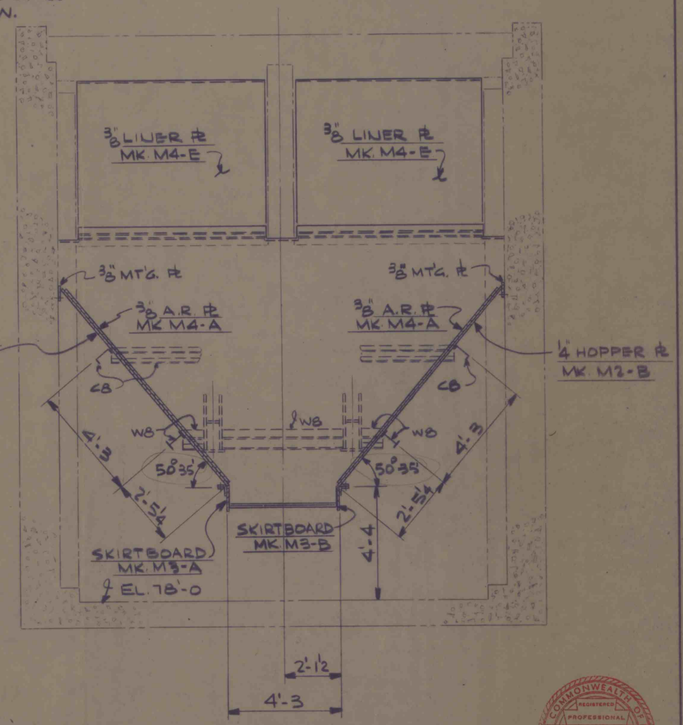

SECTION B-B

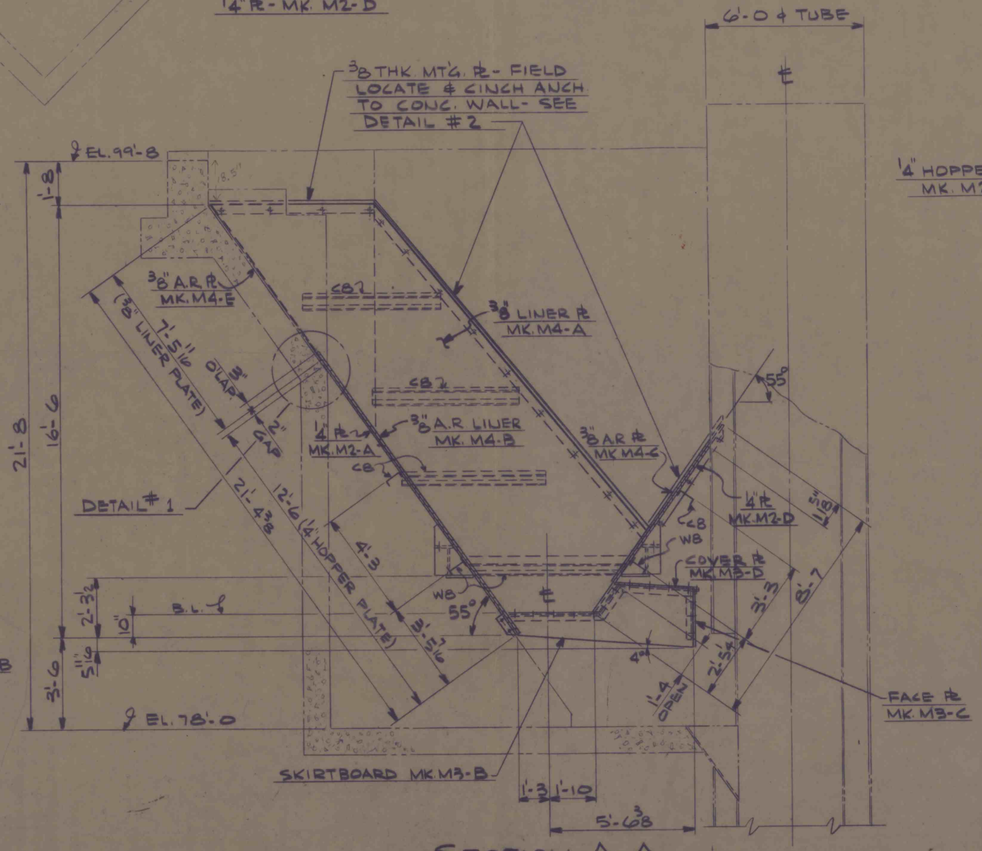

SECTION A-A

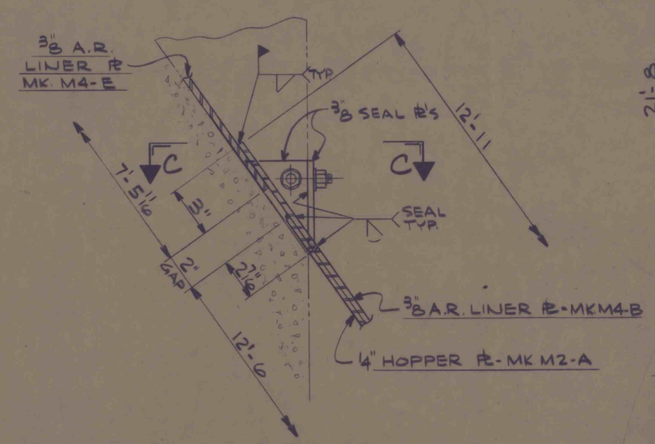

DETAIL # 1

IMAPS # 15174

DEC. 1 9 1986

NO.	DATE	REVISION

THIS DRAWING AND ALL INFORMATION THEREON IS THE PROPERTY OF SLOGAN ENGINEERING CO. AND IS CONFIDENTIAL AND MUST NOT BE MADE PUBLIC OR COPIED UNLESS AUTHORIZED BY THE OWNER AND IS SUBJECT TO RETURN UPON DEMAND.

SLOGAN ENGINEERING
ENGINEERS • DESIGNERS
PITTSBURGH, PENNSYLVANIA

HELVETIA COAL CO.
LUCERNE # 6 MINE
HOMER CITY, PENNSYLVANIA
COAL TRANSFER STATION MODIFICATIONS
COAL LOADING HOPPER - ARR'GT. & DET'S.

SCALE: 3/8", 3/8" = 1'-0
DATE: 11/19/86
DRAWN BY: T.J.M.
CHECKED BY:
DRAWING NO. E-3386-M1

IMAPS # 15174