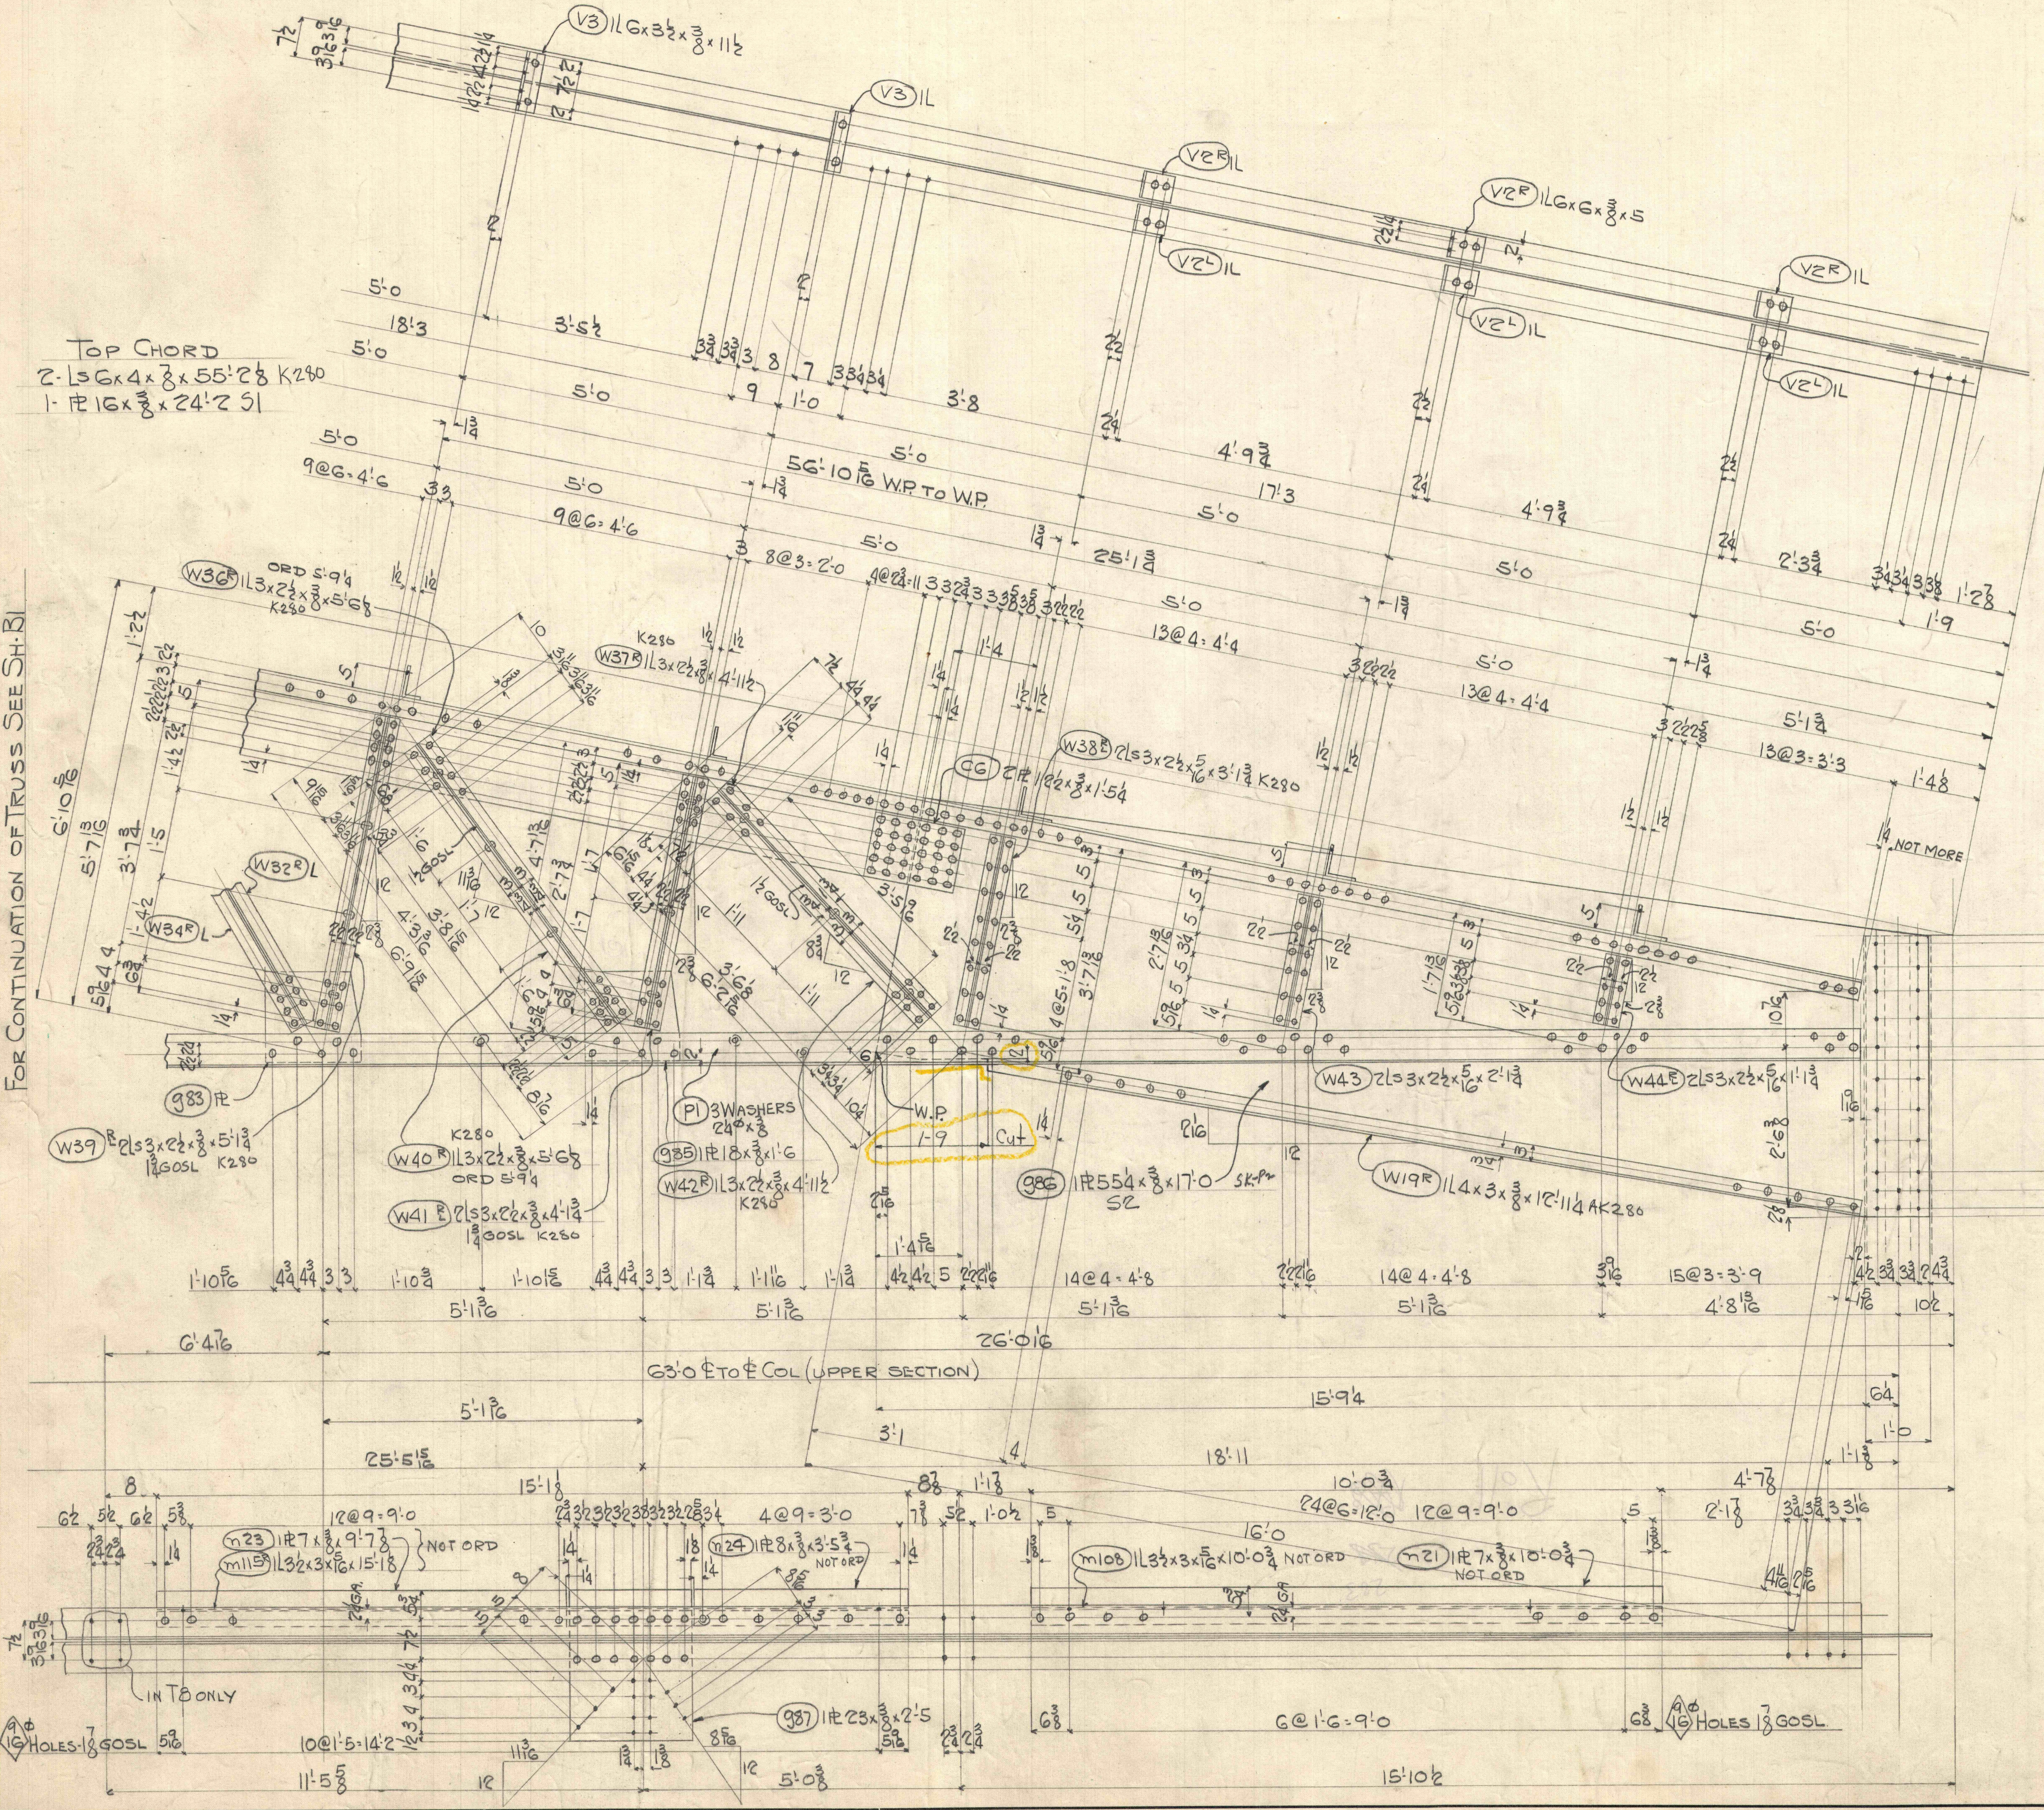

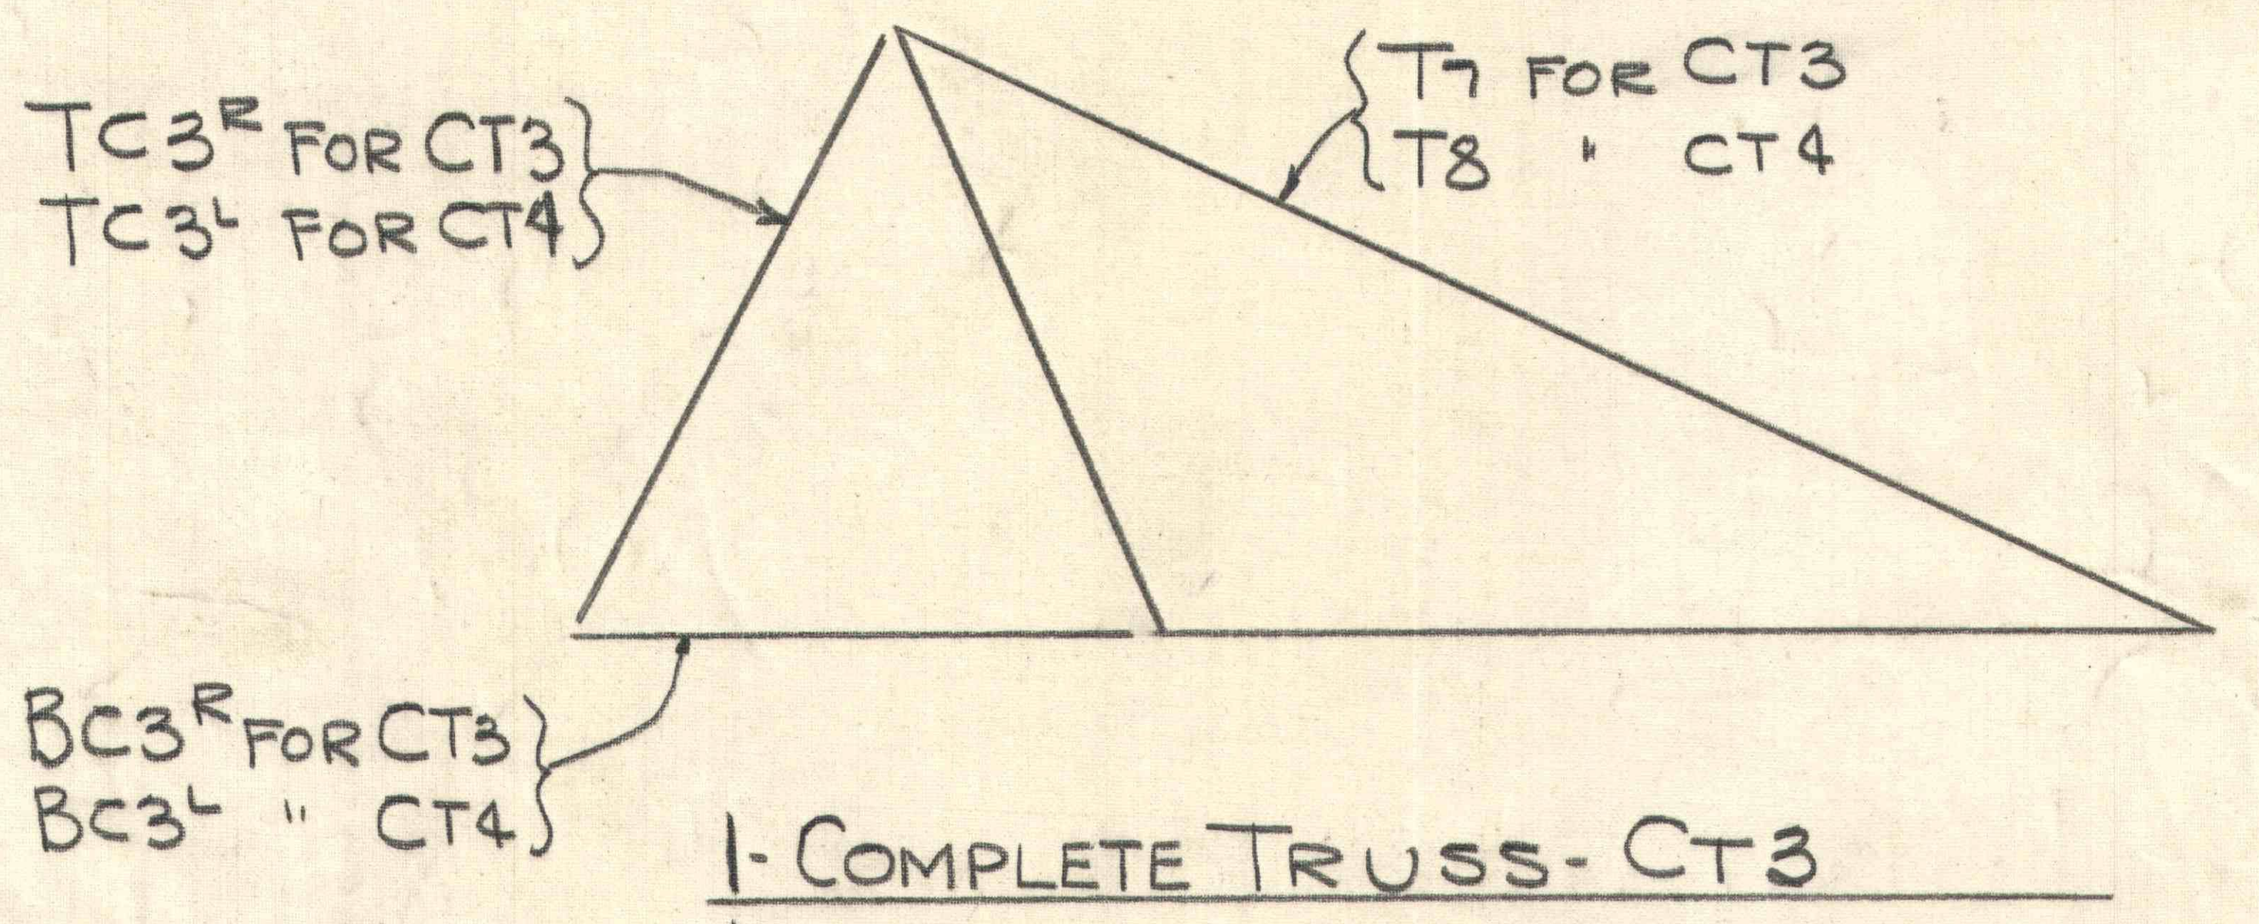

1- COMPLETE TRUSS - CT3
1- do - CT4

DIAGRAM SHOWING ASSEMBLY OF TRUSSES

1- TRUSS - T7 - SHOWN
1- do - T8 - OPP
1- BOTTOM CHORD - BC3R
1- do - BC3L
1- TOP CHORD - TC3R
1- do - TC3L

WORK THIS SHEET IN CONJUNCTION WITH SH. B1

JONES & LAUGHLIN STEEL CORPORATION
KEYSTONE DEPT.

FOR VESTA COAL CO. FLOREFFE PA.
JOB MACHINE SHOP
DETAILS OF MAIN TRUSSES

MADE HRN DATE 7-18-30 TRACED DATE
CH'K'D W.H. DATE 7/21/30 REVISED
RIVETS 3/4 φ OPEN HOLES 13/16 φ unless noted.
PAINT
INSPECTION
SHEET No. B2 ORDER NO. 1078-2

DRAWING B2
Total D'w'g's. BILL SHT. 7-8-9

Shop 7/23/30

FILED IN DRAWER NO. 26.

AMERICAN BLUE PRINTING CO.