




⊕ Indicates Spot Where Victim Was Caught By Slate Fall, Being Pinned Down With Right Side On Bottom, Back To Slate Post And Feet Toward "O" Face Air Course

Slate Posts 4 1/2' c-c, Intact Following Accident.

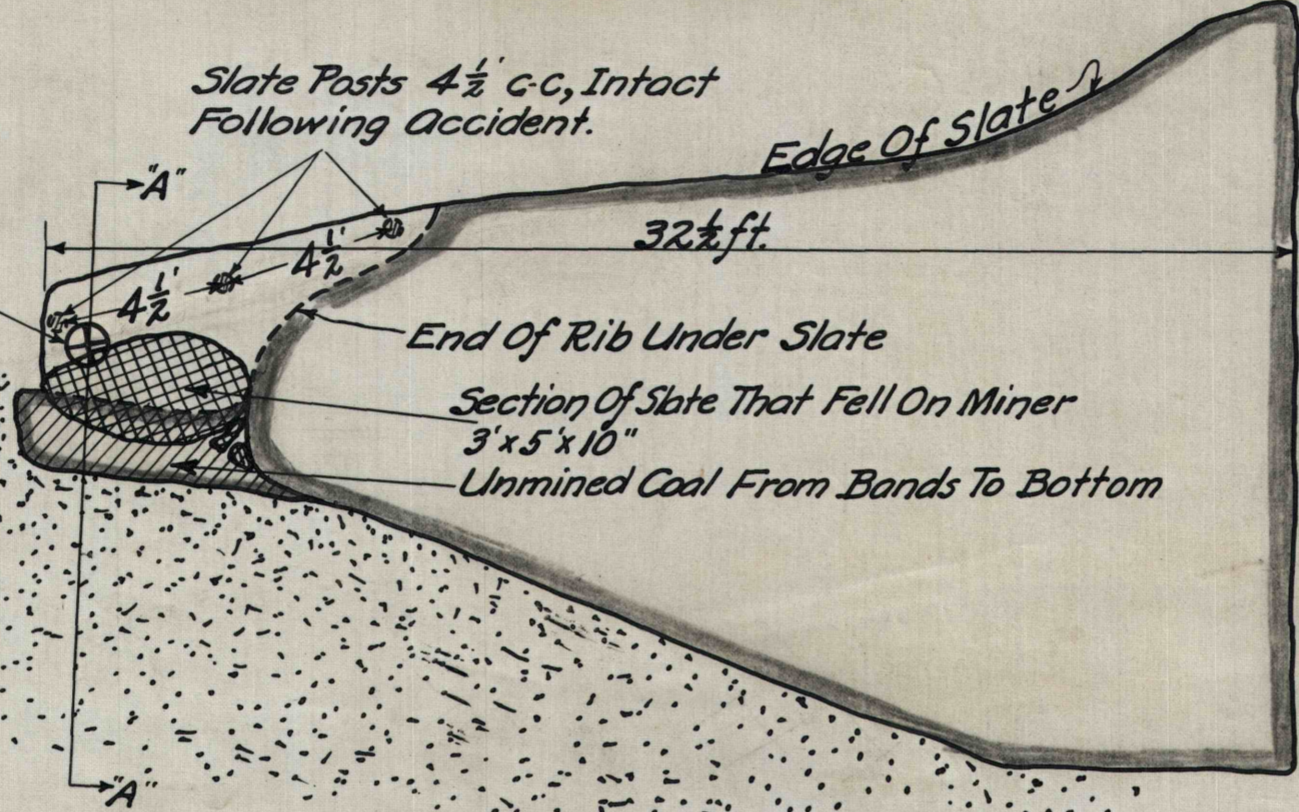

Mixture Of Dirt Coal Rock, Slate etc.

Rib Was Being Taken Out By Two Men From This Room Until Roof Became Dangerously Bad. They Were Then Moved To Back Place To Assist The Two Men Who Were Working The Same Rib From The Opposite Side.

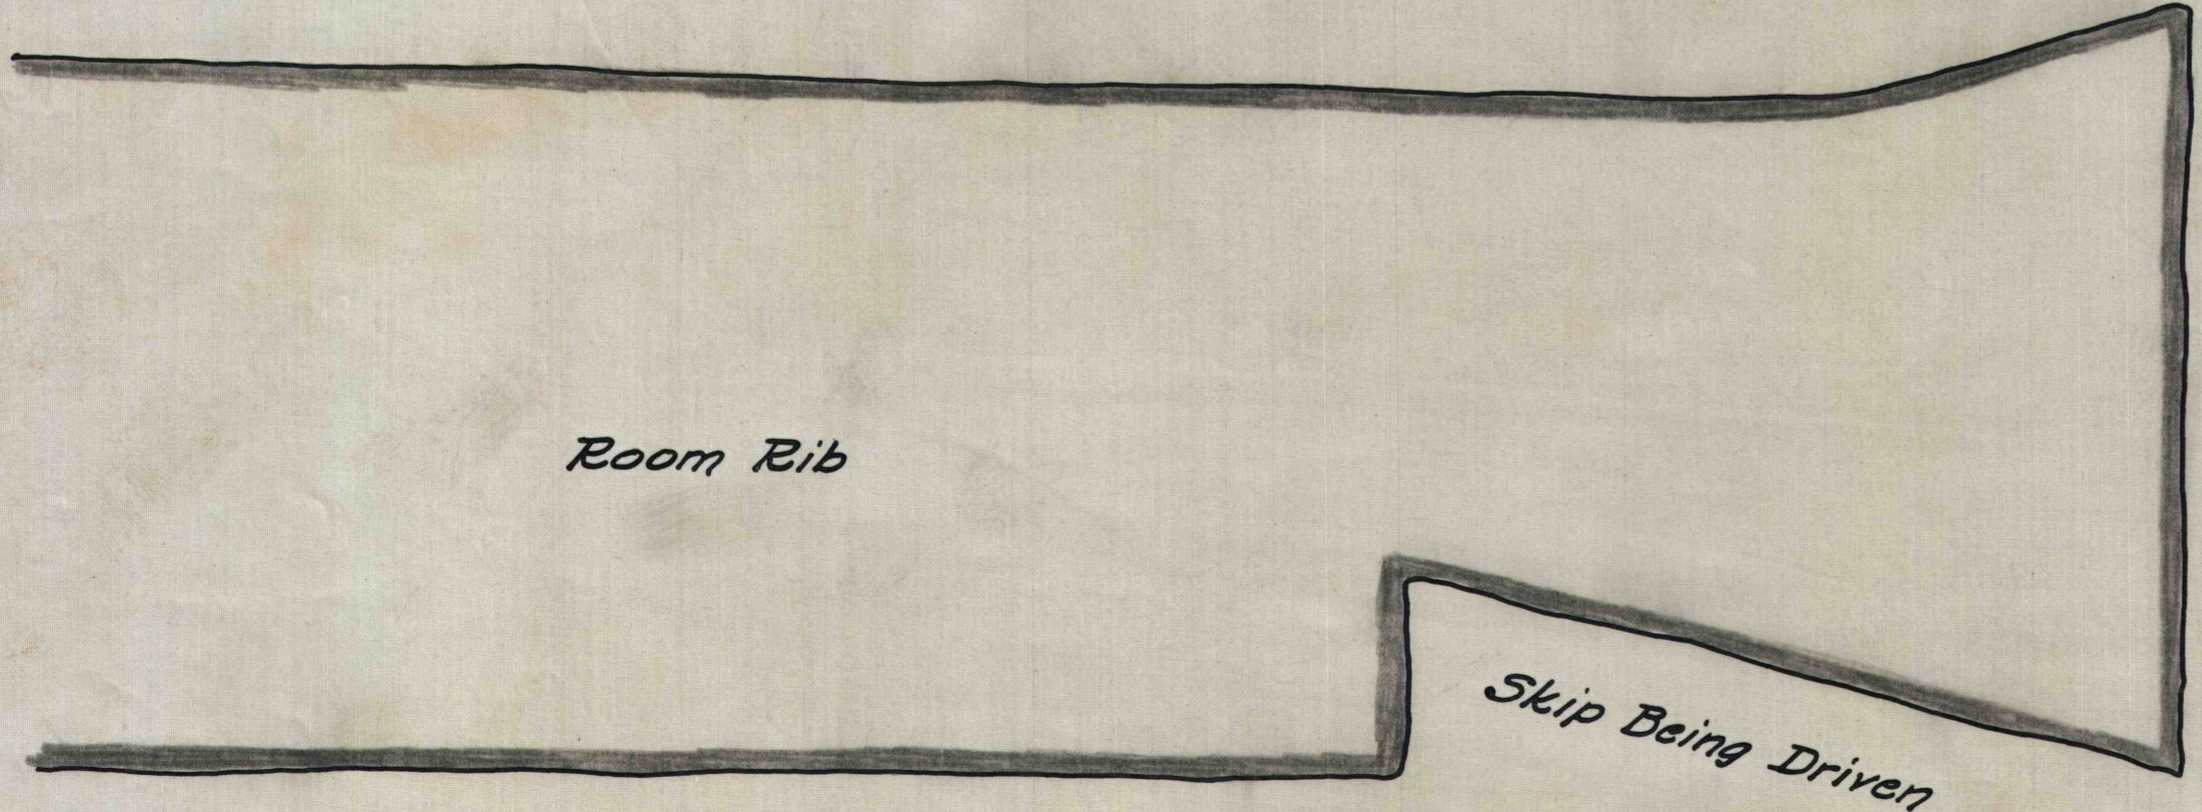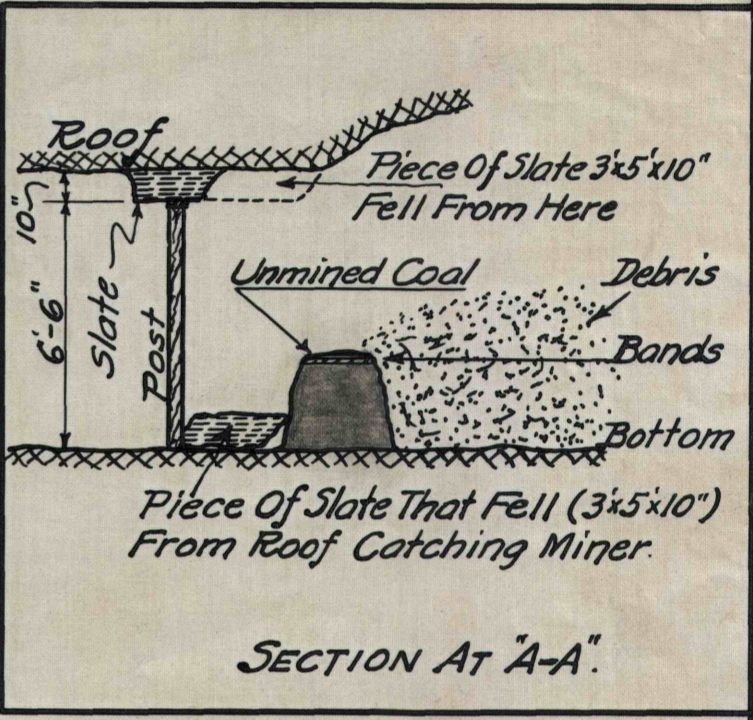

Butt Room Through Barrier Pillar - Fallen

Joe Buchan, Age 45, Married. Pick Loader - Check No 506. Injured Thursday Nov. 15-'34 - 12.30 pm. Died Saturday Nov. 17-'34 - 8.00 a.m.

THE VESTA COAL CO.
CALIFORNIA, PA.
MINE No 6 Plan Of Mine At Location Of Joe Buchan Accident In "O" Face Barrier Pillar

DR. E.E. Nov. 19-1934
TR. E.R.B. Scale 1" = 5'-0" **B-810**